

## Model 72952 SMA JACK STRAIGHT CRIMP, RG141



Model 72952 SMA JACK STRAIGHT CRIMP, RG141

# High bandwidth, small size, and durability for confident connections

### **Features**

- DC 18 GHz
- Meets MIL-C-39012, IEC 169-15, CECC 22110.
- Small size and durability for mobile communications.
- · Precision machined and gold-plated for low loss.


#### **Materials**

- Body is machined brass with gold plating.
- Center Contacts Plug is gold plated brass and Jack is gold plated Beryllium copper.
- · Insulators are high quality PTFE.
- Crimp Ferrules are copper with gold or nickel plating.
- · Gaskets are silicone rubber.

## **Ordering** Information

Model: 72952

Description: SMA JACK STRAIGHT CRIMP, RG141

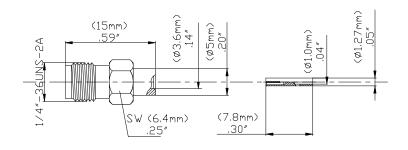

## **Specifications**

| s positionio                       |                                    |  |
|------------------------------------|------------------------------------|--|
| Impedance                          | 50 Ω                               |  |
| Frequency Range                    | DC – 18 GHz                        |  |
| Working Voltage                    | < 500 Vpeak                        |  |
| Dielectric Withstanding<br>Voltage | 1,000 Vrms                         |  |
| VSWR                               | 1.35 max.                          |  |
| Center/Outer Contact<br>Resistance | 0.003/0.002 Ω max                  |  |
| Insulation resistance              | > 5000 MΩ                          |  |
| Number of Insertions               | 500 cycles minimum                 |  |
| Temperature Range                  | -65° C to 165° C, -85° F to 329° F |  |






# Model 72952 SMA JACK STRAIGHT CRIMP, RG141

#### **Cable Types and Crimp Die Information**


|   | nnector<br>lodel # | Cable Groups | Crimp Die Cavity Size for Outer Ferrule |
|---|--------------------|--------------|---|
| 7 | 72952              | RG141        | .151 (3.8)                              |

## **Cable Assembly Instructions**


1. CUT CABLE END EVENLY AND PERPENDICULAR

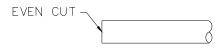

2. STRIP CABLE JACKET, TO SPECIFIC LENGTH SHOWN.

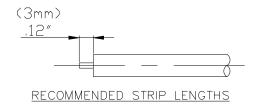

3. INSERT CONTACT PIN ONTO CABLE'S CENTER CONDUCTOR SO THAT IT IS FLUSH TO DIELECTRIC, CRIMP OR SOLDER CONTACT FIRMLY.

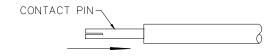

4. SLIDE CONNECTOR BODY OVER CENTER CONTACT. SLIDE OUTER FERRULE OVER BRAID AND UP AGAINST BODY ASSEMBLY.

